

Low pH

What you may need:

- Qt Pool Baron's METAL-X PLUS, or SEA-KLEAR CLARIFIER
 - ALKALINITY INCREASER
 - pH UP
-

A very low pH (below 7.0) means the water is too acidic. Acidic water commonly causes corrosion of pool equipment, rapid exhaustion of chlorine, and eye and skin irritation.

It's common for pool water with low pH to appear crystal clear; however, the pool may now be very susceptible to staining. This dramatically increases on vinyl or fiberglass pools. In fact, fiberglass pools have an inherent attraction for metallic staining.

Staining and Low pH

You will need to ultimately adjust the pH, along with related Total Alkalinity. However, before doing anything, the potential of staining must be addressed. Acidic water can dissolve metals from your underwater light, pump, valves, heater, and other components. A tiny amount of metal in the water is a staining problem.

As the pH rises into its proper range, metals in the water tend to precipitate out in the form of cloudy water and/or a uniform stain (plating) on the pool's surface. Even trace amounts of metals in the water can cause staining on some surfaces such as fiberglass.

There are no absolute solutions regarding staining. The more iron or copper in the water, the more likely staining will occur as the pH is increased. It is essential the pH be adjusted into its proper range of 7.3-7.7.

MEMPHIS POOL

The Standard of Excellence... Since 1952

2762 Getwell Rd. Memphis, TN 38118 901-365-2480
7605 Poplar Ave. Germantown, TN 38138 901-755-7946
930 W. Poplar Ave. Collierville, TN 38017 901-854-6423
www.memphispool.com

In general, stains are often prevented as follows:

1. Add 1 oz. of METAL-X PLUS for each 1,000 gal of water. For example, add 25 oz. for a 25,000 gal pool.
2. Do not superchlorinate or shock the pool until the pH has been back in proper range for at least 48 hours. Afterwards, we suggest shocking only with WHITE LIGHTNIN' non-chlorine shock.
3. Adjust the Total Alkalinity to 80-120 ppm. Add no more than 8 lbs of ALKALINITY INCREASER every 6 hours. This process will also slightly raise the pH.
4. Test the pH and slowly raise it into range. Add 1-2 lb of pH UP every 6 hours, and check pH until you achieve a pH of 7.3-7.7.
5. After pH is in its proper range, add METAL-X PLUS according to instructions or SEA-KLEAR Clarifier (ask for instructions) to remove the metals if more than 0.4 ppm of iron or copper still remains in the water.

Most stains can be removed, but it may require time and some investment in chemicals. Our staff can help you select the appropriate treatment if staining does occur.